


UNITY 600 upgrade to UNITY600 Plus:

Lock signal problem:

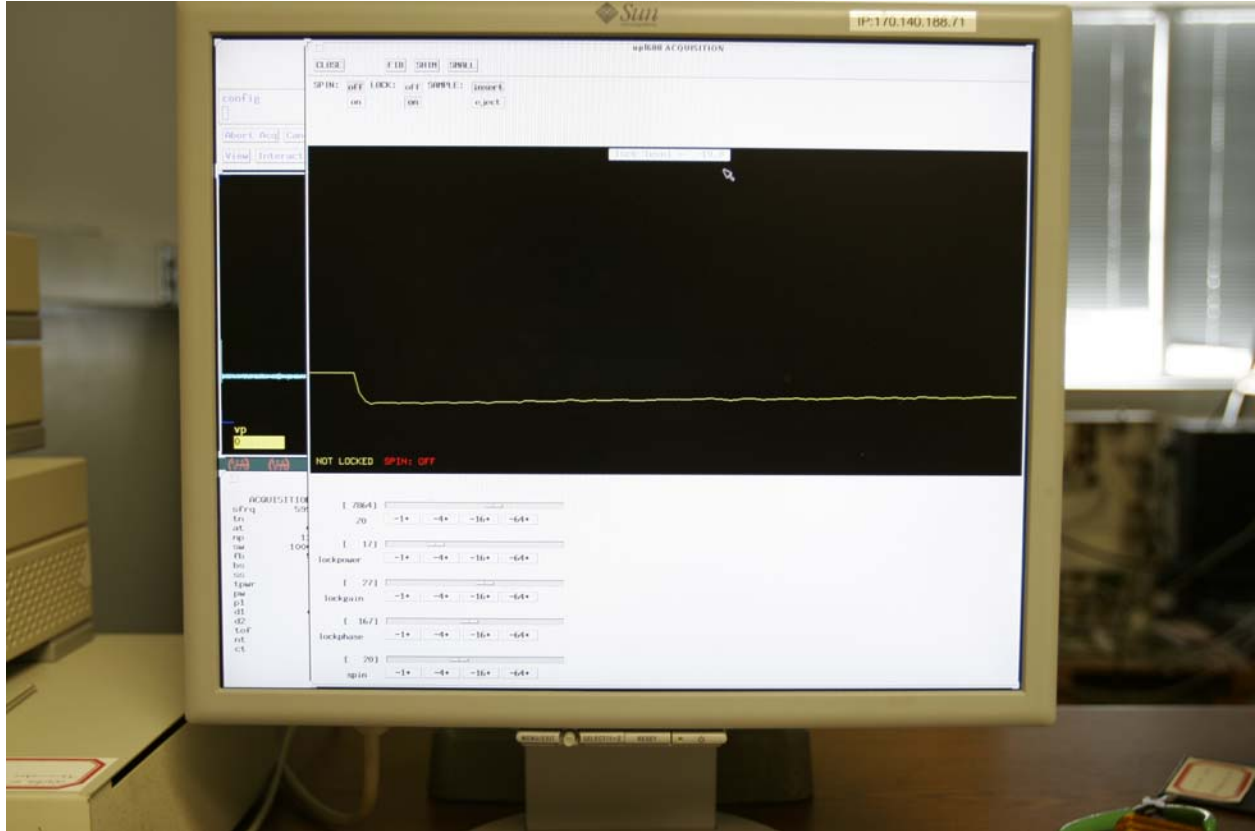




It could be locked, but the signal is 180 degree difference.

It is required to reset the polarity switch on one of the shim board:




Shim power supply unit on the unity plus console.


Open the ship power supply unit.

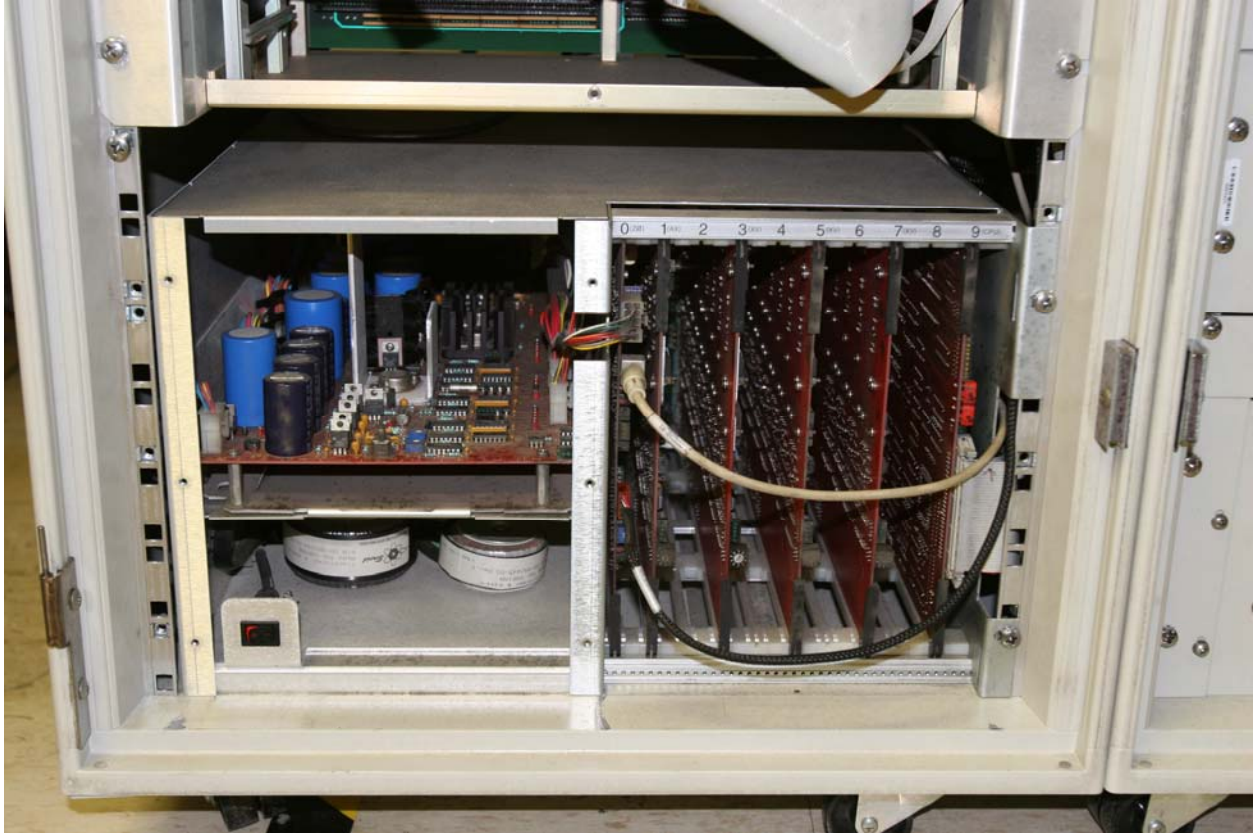


Open the front panel:

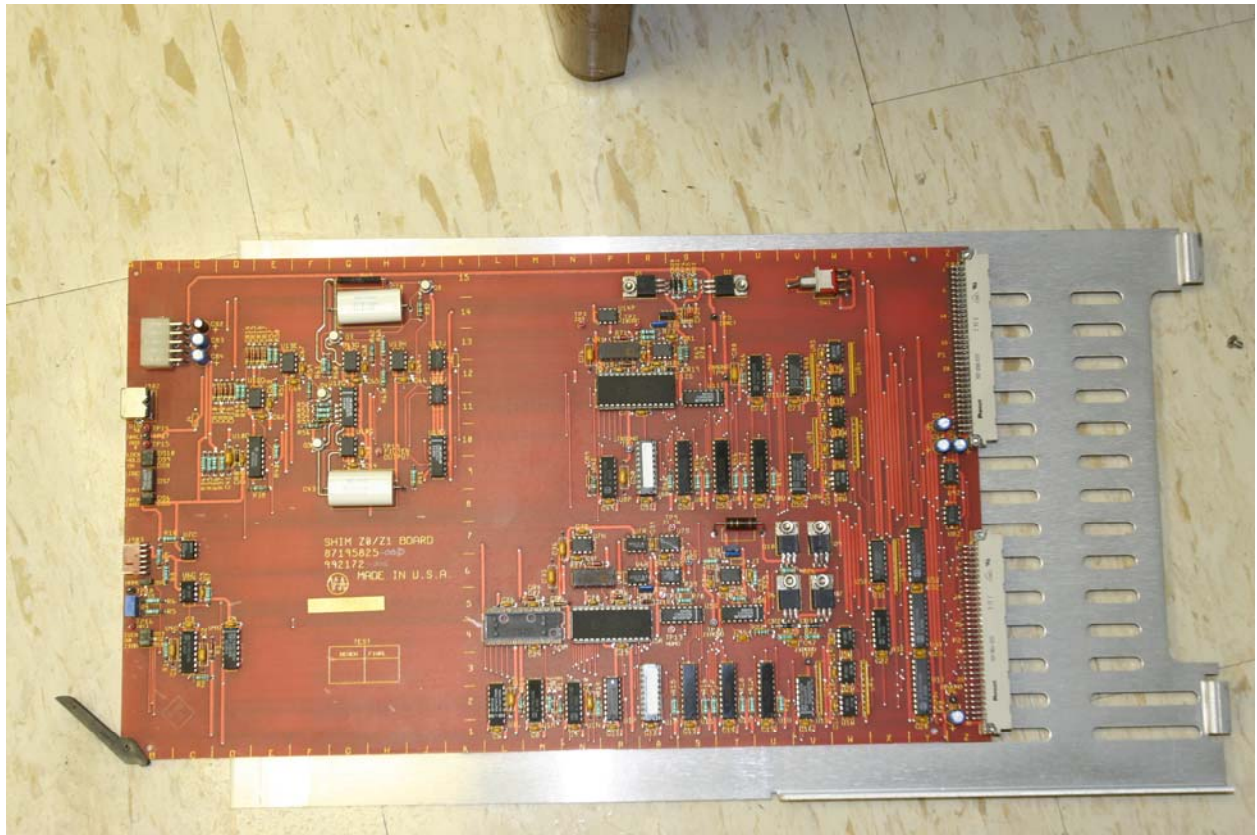

Pull out the Z0/Z1 shim board

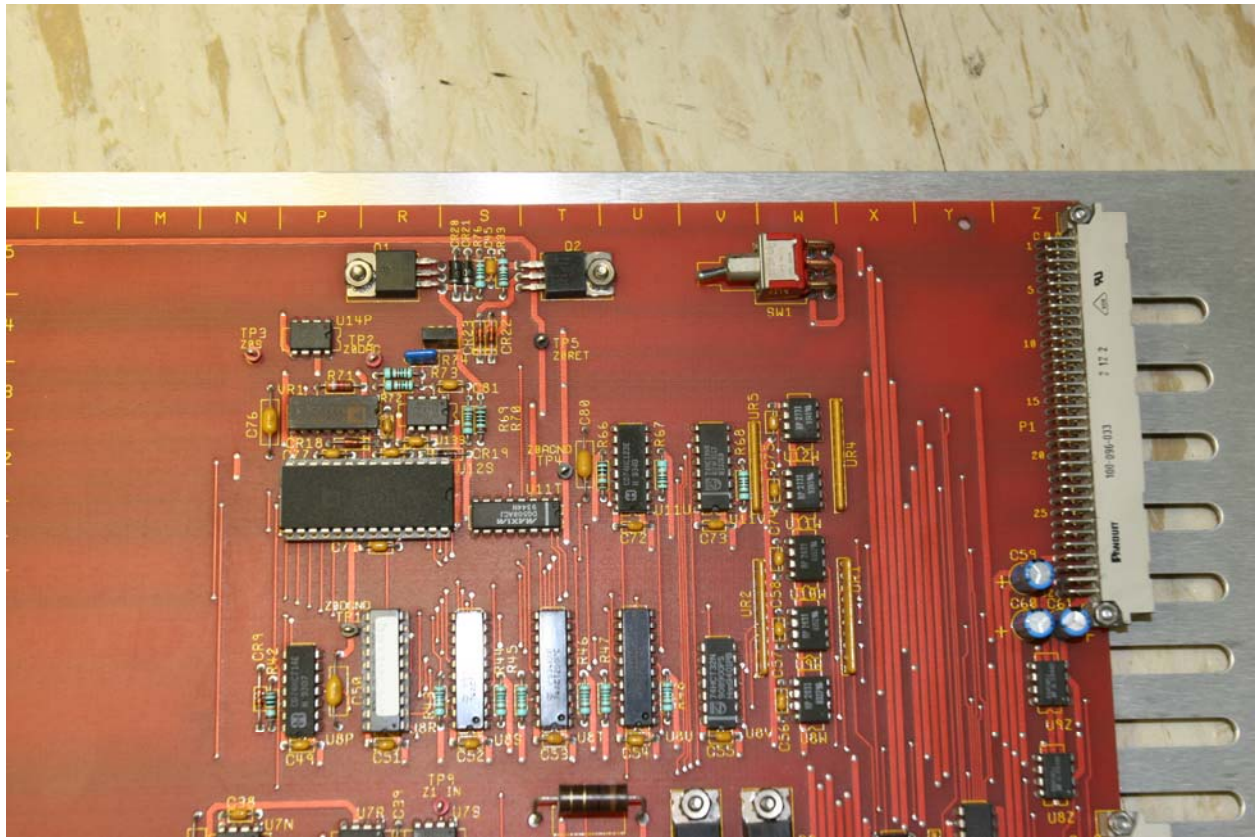

The sw1 is the polarity switch. After flip it, and reinstall the board. Power on the console.

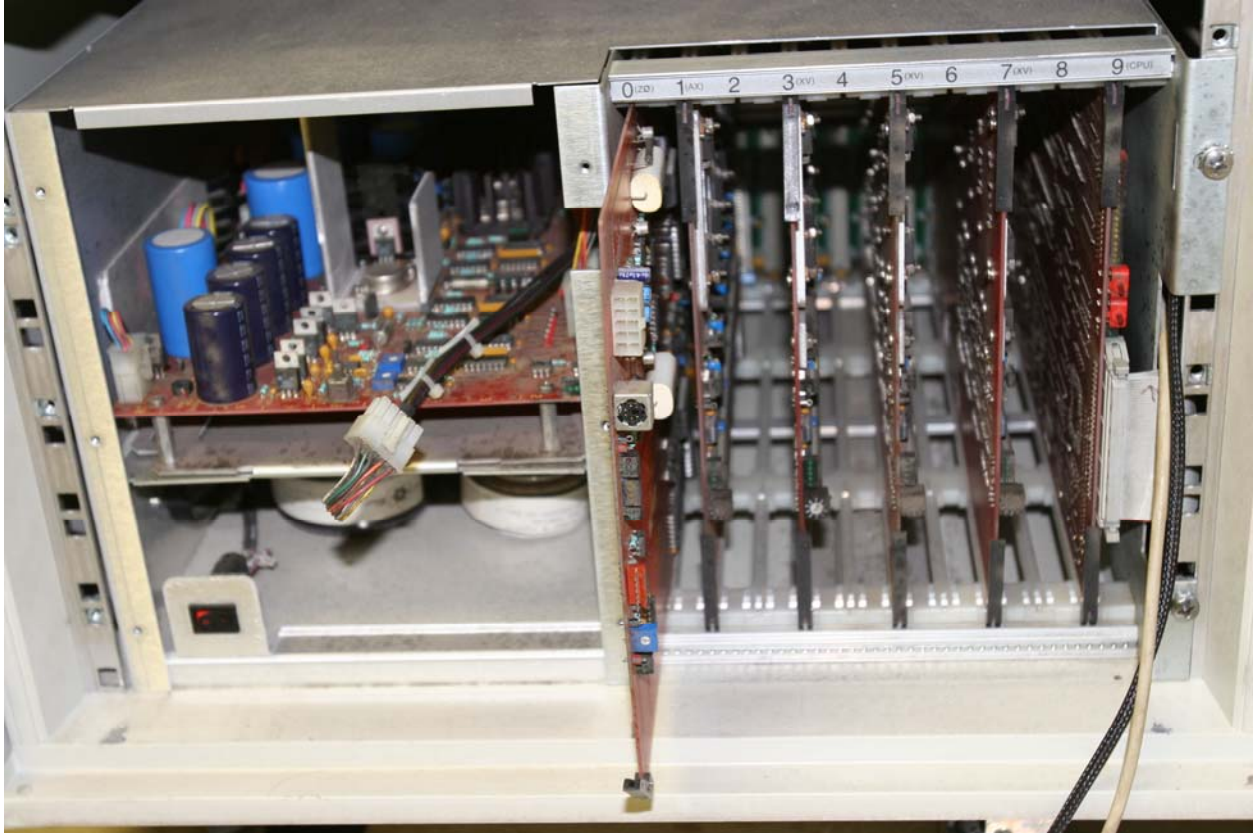

The lock signal should be reversed.